

Potenza F., Rinaldi C., Ottaviano E., Gattulli V., “A robotics and computer-aided procedure for defect evaluation in bridge inspection”, Journal of Civil Structural Health Monitoring, vol. 10, pp. 471-484, 2020.

## **A robotics and computer-aided procedure for defect evaluation in bridge inspection**

**Francesco Potenza<sup>1</sup>, Cecilia Rinaldi<sup>1</sup>, Erika Ottaviano<sup>2</sup>, Vincenzo Gattulli<sup>3,#</sup>**

<sup>1</sup> Department of Civil, Construction-Architectural and Environmental Engineering, University of L'Aquila, Via Giovanni Gronchi 18, 67100 L'Aquila, Italy

<sup>2</sup> Department of Civil and Mechanical Engineering, University of Cassino and Southern Lazio, Via G. Di Biasio 43, 03043 Cassino, Italy

<sup>3</sup> Department of Structural and Geotechnical Engineering, Sapienza University of Rome, Via Eudossiana 18, 00184 Rome, Italy

<sup>#</sup>Corresponding author: [vincenzo.gattulli@uniroma1.it](mailto:vincenzo.gattulli@uniroma1.it)

### **Abstract**

*Image processing may enhance condition assessment of bridge defects. In this perspective, we propose a robotics and computer-aided procedure which enables quantitative evaluation of defect extension with a specific storage organization by Unmanned Aerial Vehicle (UAV). The methodology for defect evaluation uses color-based image processing. Data contained in digital images are taken on pre-classified structural elements. A campaign of UAV-based inspections has been performed to evidence the potentiality of the proposed procedure. Recurrent defects, occurring in infrastructure belonging to the Italian National railway system, allow evidencing the main features of the developed image-processing algorithm. The proposed process of damage detection and quantification is discussed with respect to both the level of automation that can be reached in each phase, and the robustness of the used image processing adopted procedure.*

**Keywords:** Defect detection, digital image processing, computer aided engineering, railway bridge, robotic inspection, semi- automatic procedure, infrastructure management

## 1. Introduction

Infrastructures can be exposed to different loading conditions, recurrent ones due to vehicular traffic and extraordinary ones caused by earthquakes, wind, and strong rain. The consequent induced stresses may determine structural deterioration and damage, which can even cause catastrophic collapses related to significant socio-economic losses [1]. Therefore, the issues related to the possibility of reaching/increasing a level of automation for inspection and maintenance of infrastructure are still prone of research interests. During these last years, the classical activity conducted doing human inspectors by visual quality control for damage assessment is under a deep innovative renovation due to new available tools coming from Information and Communication Technologies (ICT). Indeed, for example, current visual inspection, which highly relies on an inspector's subjective or empirical knowledge that can induce false evaluation [2], can be enhanced by different robotic/automatic assisted operation.

Usually, the actions performed by inspectors require long time to examine large areas, which may be difficult to access. Inspection can be also performed with specialized equipment like large under bridge units, large trucks, special elevating platforms or scaffolding on structures.

Those solutions are in most cases expensive and cause high logistical efforts and costs as well as high personnel costs for the specially trained machine operators. These units can even interfere with operational conditions of structures and infrastructure. Additionally, specially trained staff, like industrial climbers, can access the site for the inspection, but they can rarely evaluate which influences detected damage can have on these structures. Therefore, they can only take photos or videos of the concerned part of the structure, which must be further analyzed by civil engineers after data recording.

In the meanwhile, the results obtained by more affordable visual inspection campaigns can be organized in a Bridge Management System (BMS), as in the case of DOMUS (in Italian Diagnostica Opere d'arte Manutenzione Unificata Standard), which is currently used by the Italian National Railways Company (RFI) [3], in order to

evaluate bridge condition and to manage maintenance. In addition, several Nondestructive Testing/Nondestructive Evaluation (NDT/NDE) technologies for structure and infrastructure inspection are currently accompanying visual inspection, such as radiographic testing, liquid penetrant tests, and active infrared thermography (e.g. [4], [5]). In particular, in the latter references it is reported, those sensors such as a camera and/or IR (Infrared Radiation) camera are placed at a given distance of the surface to be analyzed. Additionally, sensors can be mounted at the tip of a robotic manipulator (such as UAVs or mobile robots) and its position and orientation can be controlled in order to ensure the relative position and orientation with respect to the observed object [6]-[8]. Recent works address the problem of the automation of inspection and maintenance tasks based on robotic systems [9],[10]. Existing automatic or robotic systems based on ground or aerial solutions have been proposed for inspection of dangerous sites or those difficult to access, but at the present state of the art, human-based procedures are not yet completely substituted, although their inherent evident risks in working conditions.

Examples of ground systems used for inspection are wheeled robots [11], legged robots [12], but the more efficient type of locomotion is the hybrid one combining the advantages of both types, as discussed in [13],[14]. In case of the inspection of vertical surfaces robots with wall climbing capability were developed by using magnetic devices [15], or using vacuum suction techniques [16].

Recently, Unmanned Aerial Vehicles (UAVs) have shown a great advantage in inspection applications, showing potentialities such as extended flight time, great stability [17]. Remote controlled UAV equipped with high definition photo and video cameras can be used to get high quality inspection data.

The use of robotics is a new and powerful trend for the automation of inspection/maintenance. Although automated and robotic systems for inspection, together with newer measurement techniques can significantly enhance structures and infrastructures inspections, the development level of these robotic systems is still much lower than in other areas and needs to be better developed. In this sense, automated or semi-

automated inspection process will reduce costs, reduce the inspection time, increase accuracy and safety. Compared with human inspection, the robotized inspection could scan vertical surfaces of bridges as well as horizontal surfaces at the bottom of bridge decks, reach hard-to-access places, take close-up pictures, collect NDT data and transmit to host PC for further analysis.

The integration among robotics, automation and Information and Communication Technologies (ITC) allows creating useful tools able to help to generate very reliable models, which are helpful in the decision-making processes [18]. In addition, collected data could be processed and further used to create different kind of models (Geographic Information System (GIS), Building Information Modeling (BIM), Finite Element Model (FEM)). The output of the modeling phase can be further elaborated together with information resulting by the direct treatment of other data, as in the case of the damage detection. Finally, the outcome of the information processing helps operators and Governments in decision-making [18].

Most of infrastructure and civil structures are made by concrete, steel and masonry, which are prone of cracks due to creep, shrinkage and corrosion of reinforcements. Crack information (e.g., the number of cracks and crack width and length) represents the current structural health indicators, which can be used for the proper maintenance to improve the structural safety [19]-[22]. Very often different damages in buildings and bridges (e.g., cracking, spalling, deformation, or collapse-induced debris) could be captured using a commercial digital camera. Therefore, damage detection by visual inspection can be assisted by image analysis and processing. In this regard, two main tasks should be tackled, namely object recognition, and damage detection and quantification.

Standard techniques for object recognition can be based on the Haar wavelets [23]. Another approach aims at finding correspondences between two images of the same scene [24]. Image processing based methods can be classified as based on color information, textural information or a combination of the two to segment and extract regions of interest in images. Texture and color based segmentation approaches are the primary modes of segmentation employed for image analysis. While both approaches have important

applications in image processing methods, the color-based methods have been researched largely. Texture may be considered as an innate property of surfaces and this technique finds particular relevance in cases where the regions of interest are more separable from the background based on their texture than color.

Color Detection techniques can be used for the detection and classification of local structures (i.e. edges, corners, and T-Junctions) when the discriminant is the color. Color is important for many applications such as image segmentation, image matching, object recognition, visual tracking in the fields of image processing and computer vision [25]. The Color Detection Techniques allow fast processing and are highly robust to geometric variations of the object pattern and viewing direction [26]. One possible choice for the color space is RGB, which is widely used for many applications, as it was presented in [27]. In [28] a comparative analysis is proposed among different color spaces to evaluate the performance of color image segmentation using an automatic object image extraction technique. The outcome of the study revealed that that the segmentation depending on the RGB color space provided the best results compared to other color spaces for the considered set of images. In [29] an image processing technique for rapid and automated crack detection was proposed as based on RGB color space. The comparative study among different color spaces in [30] does not show significant differences. All adopted color spaces actually provide a meaningful segmentation. Although RGB is not the best solution when a great variability of chromatic and intensity changes is present in the images, such as the face recognition problem, for other applications involving crack detection, automatic or semiautomatic object image extraction technique, RGB color space is one of the most used [31]-[36]. Recently, an algorithm based on the Convolutional Neural Network is considered in [37] to detect concrete cracks without calculating the defect features and also for simultaneous detection of multiple types of damages were proposed [38], [39]. Furthermore, a modified architecture of Fusion Convolutional Neural Network to handle the multilevel convolutional features of the sub-images is proposed and employed in [40] for crack identification in steel box girders containing

complicated disturbing background and handwriting.


In this context, the present work proposes a procedure, which starts from the use of aerial and ground robotics, and permits a defect recognition for railway bridges, together with the consequent description and extension evaluation. The aim is to identify defects such as efflorescence, corrosion, paint gap, loss of thickness, moss and/or plants that are the typical defects considered in DOMUS. Unlike the crack identification task which is addressed mainly by Convolutional Neural Network algorithms and which requires a suitable object distance and focal length [40], in this work the defects to be detected are not characterized by a shape, they are wider (they occupy larger areas of the structural elements) and the object distance is greater. For these reasons, the procedure here proposed, based on Digital Image Processing (DIP), is more suitable for the recognition of wide and extensive defects. In particular, a Color Detection Technique is used and it allowed detecting different types of defects associating different ranges of color to each defect. Therefore, the classification is not based on the feature of the defect but on its color. ~~In DOMUS context, this is an advantage because the defects are wide, extensive and they are not characterized by a feature (as is instead the case of a crack).~~ The drawbacks of the color-based techniques are related to the light conditions; for the kind of defects to which this work is addressed the light conditions did not affect the success of the recognition. In the first part of the paper, robotic operations are reviewed and, on this basis, a precise procedure is described for the automatic acquisition of images and database storage, evidencing the interrelation with the BMS adopted as framework. The second part of the paper deals with a procedure for defect evaluation based on DIP. The methodology here proposed follows, research endeavours attempt to empower visual inspection and optical imaging by quantitative image analysis; to achieve automatic or semi-automatic damage detection [41], [42]. The features of the developed algorithm are discussed. A validation of the work is described based on a robotic acquisition campaign using UAV on railway bridges belonging the Italian National network.

## 2. Defect evaluation procedure

A commonly adopted and recognized methodology for visual inspection, according to a computer or ICT based approach, identifies the concept of so-called Engineer-Imaging-Computing (EIC) unit [43], which consists of an expert civil engineer with his equipment in the working area. Each EIC unit consists of two basic elements namely, the engineer, who is the expert in damage assessment, and a digital camera. The standard method then heavily relies on human activities eventually performed with the aid of a device for image capturing. *This section illustrates a new proposed framework to acquire data and to evaluate damage extension on bridge elements by the use of automation. The main activities can be outlined providing the specific aspects of the method related to the enhancement reachable by the automation of the process, as the following:*

1. Image or video capturing along pre-defined paths: a mobile device, either a ground or an aerial system carrying the data acquisition system is used for the phase of the image and video capturing. For bridge inspection regular digital camera are considered, for which a basic requirement is that it can be tethered wireless to the mobile computing device. Alternatively, data is transferred to PC after data recording for further elaboration.
2. Contextual interface: the DOMUS BMS has been considered to describe both structural elements and damage or cracks in the infrastructure. The path followed by the robots is driven by the information present in the database, which describes the elements of the inspected bridge.
3. Experimental calibration: evaluation of the image analysis accuracy through a comparison between the information coming from the image processing and the on-site measurement.
4. Defect analysis: defect recognition and defect extension evaluation by image processing. The first one is pursued by processing the information contained in the database and obtained by the image processing while the second one is performed based on the developed algorithm successively here described. The flow chart in Figure 1 describes schematically the proposed procedure showing also the outcome: fast damage evaluation, defects evolution, defect severity and

maintenance planning. In the block diagrams, the horizontal arrows indicate that the procedure can be reiterated based on the information obtained by a specific phase.

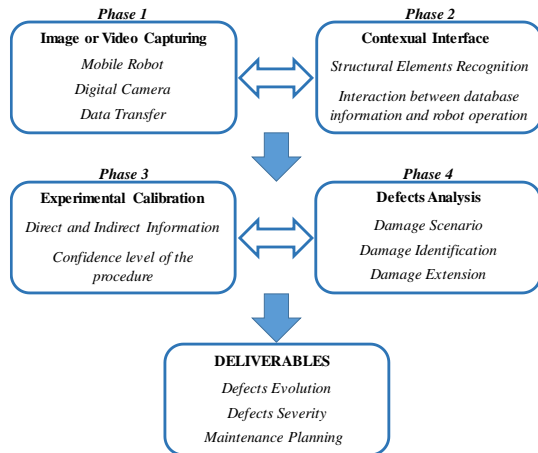

**Fig 1** Novel framework of the defect evaluation for image-based bridge inspection

More specifically, Phase 1 dealing with image or video capturing can assist and partially reduce traditional visual inspection performed by expert personnel. Research in this direction has driven the development of vehicle-mounted imaging.

~~Although in the current practice human inspection still dominates the activity for general inspection in a complex or/and hard access built environment, automatic or semiautomatic systems can be a possible solution, especially for those environments that are difficult or dangerous to access. However, all this specialized equipment than can be used are experimental tools and are heavily customized to a certain built environment.~~

Different technological solutions for Phase 1 are considered in the proposed procedure in order to determine optimized features for the robotized inspection based on the information contained in the BMS. The first possible solution is determined by the use of camera or video capturing system, at this level the data acquisition system can be still carried out by the operator, but it has the main advantage to get data even from sites inaccessible or dangerous and difficult to access. The acquired data are stored and further analyzed and processed, even for the assessment of defect evolution. ~~In addition, the security of the human operator is a crucial issue of the task.~~

Solutions for Phase 1 can be also semi-automated


with the use of ground or aerial systems tele-operated by expert users. Main characteristics of the robotic agents that may be used are summarized in Table 1. This higher level of automation allows faster and safer operations because permits the personnel to work by remote control avoiding onsite direct inspection. Since a robotic agent performs the operation of image and video capturing the overall cost, risks and danger issues are drastically reduced.

In this regards, robots and automatic systems are used for two main tasks referring to the application under study, first to perform a mechatronic survey, that is, collect in a rational/automatic way information of the site of interest with the aid of data acquisition techniques. Alternatively, or additionally, the robots can be used to access the sites, which can be complex to be explored by human operator, either from the ground, by the use of mobile robots, and/or by air, with the aid of drones (UAVs). Mobile or hybrid solutions with wheels and legs have been developed for the automatic inspection of dangerous sites [44],[45]. Although robotic systems for inspection, together with newer measurement techniques can significantly enhance infrastructure inspections, the development level of these robotic systems is still much lower than in other areas and it needs to be better developed. Indeed, good perspective is view for the automated inspection process, which will decrease costs, increase the inspection speed, accuracy and safety [46].


Compared with manual inspection, the semi-automated inspection carried out with the aid of aerial and ground mobile systems, allows scanning vertical surfaces of bridges and buildings as well as horizontal surfaces at the bottom of bridge decks, reach hard-to-access places, take close-up pictures, collect NDT data and transmit to host PC for further analysis.

Robotic solutions, thus allow the survey even in unsafe, dangerous, and difficult to access areas and sites, substituting subjective visual analysis with objective image capturing. Figure 2a shows a scheme of the use and access of **robotic and automatic solutions that can be adopted** in the proposed procedure for the monitoring and survey, which may be also used in combination with dynamic acceleration measurements of the deck vibration [27]. According to the type of structure, robotic systems can be used, as shown in Figure

2a, namely ground (mobile, walking and hybrid

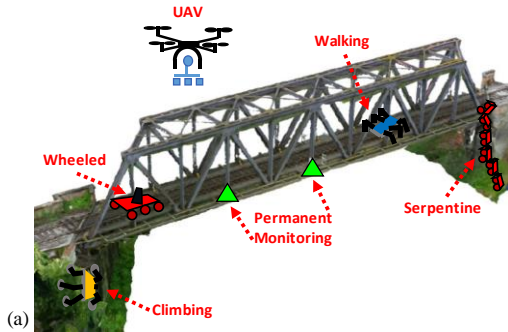

robots) UAV and climbing/serpentine.

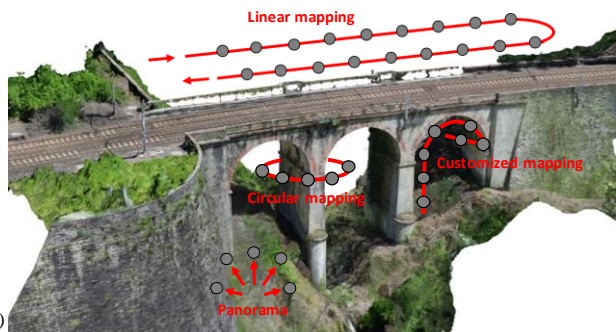

**Fig 2** Bridge image acquisition: (a) automatic/robotic systems, (b) path planning for an automatic/robotic access

**Table 1** Main characteristic of the robotic agents usable in the Phase 1 of the proposed procedure

Ground robot	UAV	Climbing/serpentine
<p><i>Advantages:</i>                      Easy access by ground                      Indoor and outdoor inspection                      High payload                      High autonomy</p> <p><i>Disadvantages:</i>                      Time consuming inspection                      Access limited to viability</p>	<p><i>Advantages:</i>                      Easy access by air                      Fast survey                      Flexible solution</p> <p><i>Disadvantages:</i>                      Short flight time                      Limitation to outdoor inspection                      Limited payload</p>	<p><i>Advantages:</i>                      Easy access in very limited space (pipes, cavities)                      Indoor and outdoor inspection</p> <p><i>Disadvantages:</i>                      Limitation by surface type                      Limited payload                      Time consuming inspection</p>

All of them present advantages and disadvantages, as reported in Table 1. All possible type of robotic solutions displayed in Fig2a) has to be used for semi-autonomous or autonomous reliefs taking into account the paths in Fig.2) and their advantages and drawbacks, as reported in Table 1. Different levels of automation can be pursued for each phase detailed in Fig. 1. In particular, in Phase 1 the highest possible level of automation deals with the fully autonomous access to the structure/infrastructure by using Simultaneous Localization and Mapping (SLAM, [47]) techniques, performing inspections by considering the possible paths reported in Table 2, as it is shown in the scheme of Figure 2b. A lower level of automation can be pursued by a tele-operated survey, in this regard planning the inspection path can be performed, in order to increase the level of automation in Phase 2. Semi-autonomous inspection can be performed relying then on operator supervision. Video and pictures can be

taken automatically, at a given rate, or they are defined by the operator.

The second phase deals with the creation of a Contextual interface, automation in the Phase 2 deals with the use of a database. Among the large amount of possible solutions and examples for the database creation for both structural elements and damage or cracks in the infrastructure, in this context we consider the DOMUS Bridge Management System (BMS) as presented in [3]. This management tool is currently used by the Italian National Railways Company (RFI), which is working on the possibility to realize automated inspections of bridges. The procedure itself contains a good level of automation because there are defined thresholds for a large number of components and defects. Therefore, the proposed procedure is inspired by the possibility to realize a whole set of actions for inspection and maintenance of bridges relying on automation. In particular, DOMUS adopts a procedure for bridge

condition assessment by visual inspection. The main modules used in the procedure are: bridge inventory, computer-aided visual inspection, automated defect catalogue, and priority ranking procedure. At the current state, the process is completely manual, i.e. no automatic procedure is performed.

A probabilistic model used to calibrate the condition evaluation algorithm has been

**Table 2** Planning and access path for automatic inspection.

Linear Mapping	Circular mapping	Panorama	Customized mapping
A linear path along the element using some reference points (points of interest), creating ideal lines and setting GPS waypoints, which are adapted to the terrain, automatically. Well suited either by ground (mobile, serpentine, or climbing) or aerial automatic agents	A circular path is created around the element once that the requested resolution/distance is set. Well suited for aerial systems	A panoramic mission is performed to get a first sight to gain an initial overview of the area to access. Well suited for ground systems. and for a concave location, such as the curved cliff face of an open pit mine, to give to enhance the quality of 3D models and it is well suited for aerial agents	Used for complex environments in tele-operated mode when there is a direct control of the agent, or through a polyline interpolation of pre-specified point of interest

developed to determine different levels of deficiency for each class of bridge structure belonging to the managed stock. The procedure allows comparison and relative ranking of deficiency conditions across different types of bridge structures.

**Table 3** Value of  $K_3$  as function of E (ratio between the defected area and the total examined area in DOMUS).

Sheet (Name and Code)	$K_3 = 0.5$	$K_3 = 1.0$	$K_3 = 1.5$	$K_3 = 2.0$
Efflorescence in r.c. – C2	$E < 25\%$	$25\% < E < 50\%$	$50\% < E < 75\%$	$75\% < E < 100\%$
Paint gap – A1	$E < 10\%$	$10\% < E < 20\%$	$20\% < E < 40\%$	$E > 40\%$
Corrosion – A2	$E < 10\%$	$10\% < E < 20\%$	$20\% < E < 40\%$	$E > 40\%$
Loss of thickness – A5	$E < 10\%$	$10\% < E < 20\%$	$20\% < E < 40\%$	$E > 40\%$
Efflorescence in masonry – M2	$E < 25\%$	$25\% < E < 50\%$	$50\% < E < 75\%$	$75\% < E < 100\%$
Moss and/or Plants - M3	$E < 25\%$	$25\% < E < 50\%$	$50\% < E < 75\%$	$75\% < E < 100\%$

The first module, the bridge inventory, consists of a complex and exhaustive database, including sufficient data to accurately describe any bridge in the bridge inventory.

The software links the seventh database section to the second main module, which is devoted to

provide automated digital assistance to visual inspections. The second module incorporates a strict, coded procedure that ensures homogeneous visual inspections over time and for different bridge types. This module has been used in the proposed procedure to produce all the information

that are necessary to operate with robots according to the previous described solution to run the inspections. Indeed, the procedure adopted in DOMUS is prone to automation, because the role of the inspector can be easily assisted by robots and expert systems. Systems, components and subcomponents of the bridge are known and described in DOMUS. During the robotized inspections, this information can be used to assign the observed damage to the subcomponents affected determining a-priori optimized and fast path for the robot. Additionally, in the following section, a procedure is proposed to evaluate the extent coefficient values for a series of defect based on image processing.

Furthermore, the procedure of assigning a defect to specifically identifiable components or subcomponents allows automatic assignment of coefficient values associated with deficiency type and structural importance. Indeed, three relevant coefficients define the importance (B), intensity ( $K_2$ ) and extension ( $K_3$ ) of the defect. All parameters can assume four values belonging to four classes, which are growing with the defect dangerousness. For example, in Table 3, the thresholds are reported for the ratio between the defected area and the total examined area (E) to evaluate the  $K_3$ -parameter. It is worth to highlight that E is given in term of percentage and it is evaluated in the current practice by the inspectors. For these reasons, the distribution of the  $K_3$ -parameter will be very coarse without pointing out which defect is really important to improve. In this sense, the desirable improvements, based on the proposed procedure, for DOMUS could be the following: (1) better evaluation of the E-parameter describing the extension, (2) possibility to reach areas not accessible by a human inspector, (3) optimization and speeding in decision-making and finally (4) automation of the procedure.

In this context, once the first phase is partially or completely automated, its outcome is a series of pictures ordered or preordered according to the type of access that has been described in Figure 2 and Tables 1 and 2 and automatically related with the inventory module of DOMUS. More specifically, the preordering of the pictures allows a fast classification of the picture to be assessed. After image processing, filling the defect database can be highly automated, referring to intensity ( $K_2$ ) and extension ( $K_3$ ) of the defect. It is worth to

note that the preordering of the structural components in the database must be the same of the image capturing. The phase 2 can be highly automated but not completely, because it needs human supervision. Apart this limitation, it gives high benefit because it reduces drastically the time needed for its completion.

The third phase deals with experimental calibration. In order to extract the required information is necessary that the acquired images possess specific characteristics. A relevant feature is related to the camera sensor resolution that allows representing the defect with a certain number of pixel. Given an infrastructure or building containing a defect, the greater will be the number of pixels representing the scene; the better will be the extraction of the inherent defect information. Using a single camera, the perspective distortion of the scene can provide a relevant error of the defect recognition. If the defect is located on a flat wall, it is very advantageous to have the camera sensor in a plane parallel to the one containing the defect, in order to minimize the perspective deformation. Even if an image improvement can be performed, environmental factors influence the picture quality. Indeed, weather conditions, camera position with respect sun, external shadows and casual interferences/disturbances, can provide different outcomes of images even if the scene is the same. Once these parameters have been set at the beginning of the survey they do not change. It is worth to mention that the use of a UAV drastically reduce the time of the survey allowing the best conditions to have the same environmental conditions and then parameters e.g. luminosity, saturation. Phase 3 is the most difficult to automatize.

The last phase deals with the defect analysis that requires the recognition and identification of both the observed object with respect to the background and the specific defect identification in the observed object.

In the last two decades, several techniques have been developed to recognize objects in digital images. The fourth phase contains a good level of possible automation. The developed software application that will be described in detail in the next sub-section allows the automatic identification and quantification of a defect in a given image.



## 2.1 The DEEP software-based image processing technique for defect extension evaluation

The software named DEEP (DEfect detection by Enhanced image Processing), developed in Visual Basic environment, is able to evaluate the defect extension through image processing. In particular, it uses Color Detection Techniques based on RGB color code processing. In this respect, the implemented procedure follows these rules

$$\begin{cases} R_{min} < R < R_{max} \\ G_{min} < G < G_{max} \\ B_{min} < B < B_{max} \end{cases} \quad (1)$$

$$RG_{min} < |R - G| < RG_{max} \quad (2)$$

$$GB_{min} < |G - B| < GB_{max} \quad (3)$$

where the letters R, G, B stand for the color components of red, green, and blue to which the human retina is sensitive. These components, which are represented by integers, are mixed together to form a unique color value. Each color component can range from 0 through 255.

The selected values have to satisfy the Equations (1)-(3) that depend on 10 parameters:  $R_{min}$ ,  $R_{max}$ ,  $G_{min}$ ,  $G_{max}$ ,  $B_{min}$ ,  $B_{max}$ ,  $RG_{min}$ ,  $RG_{max}$ ,  $GB_{min}$ ,  $GB_{max}$ . The selection of the optimal values of these parameters is performed by an extensive parametric analysis on acquired images.

In the following section, a procedure for the selection is presented and illustrated through an example taken by a real case. Furthermore, the role played by the constraints used to extract the number of pixels associated to a faulty portion of the examined component can be described as follows.

Equation (1) sets the possible ranges for the RGB colors independently each other. It permits to select the pixels associated to the RGB triplets that

satisfy at the same time the three inequalities. Equations (2) and (3) introduce the possibility to select an admissible range for two chromatic distances ( $|R-G|$  and  $|G-B|$ ). These added constraints permit to select only the pixels that, even if they change their absolute color, preserve their chromatic distance. It is right to highlight that the limit values for the definition of the ranges in the Eqs. (2) and (3) correspond to the maximum and minimum distance evaluated through chosen limit values in Eq. (1). A large choice of the interval fixing large limit values makes the constraint null. Differently, accurately selected limit values, RG and GB, determines the coupling of inequalities (1-3) allowing the evaluation of defect extension cleaned by the brightness effect of the selected picture.


The addressed procedure has been implemented in DEEP a software developed in Visual Basic. In this framework, DEEP has been used for two main purposes:

1. *Detection of structural objects* (e.g. bridge structure or components);
2. *Detection of defects* (e.g. corrosion or paint stripping, efflorescence, presence of vegetation, etc).

A general view of the software working is shown in the flow chart reported in the Figure 3. Substantially, can be individualized three toolbox packages:


1. Management commands;
2. Pre-processing transformations;
3. Processing procedure;

When the software is started the menu permits to activate the classical commands needed to manage the software (open, show/hide an image). Subsequently, can be active the toolbox useful to carry out some pre-processing transformations like scalegray, brightness, contrast. Of course, these two command areas can be repeated to the aim to get the best image to be processed.

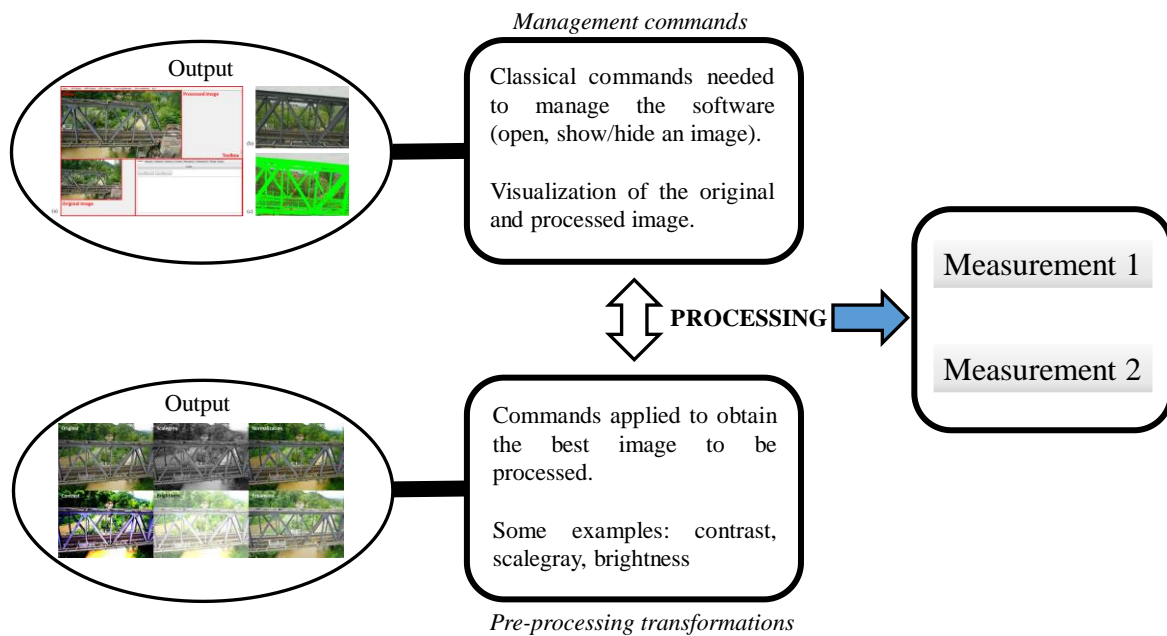

**Fig 3** Flow chart that highlights the main skills of the DEEP software.

The processing commands inserted in DEEP are two: Measurement 1 and Measurement 2. In the first one a segmentation using classical RGB method is implemented (Eq. 1). This tool selects the pixels associated to a specific range of values for each fundamental color R, G and B. Moreover, the width of these intervals can be different in each of the three cases. An example of this procedure is shown in Figure 4a where the target was the recognition of the structural elements in the picture. Looking at the processed image, it is evident how not all the pixels representing the structural elements have been retained, especially the ones positioned to the contour of the image. The example evidences the need of planning of path and consequently distance with respect to object. The results are given in term of number of pixels related to a specific color within a range, number of pixels of the whole image and ratio between these two values (ratio color/image). The Measurement 2 command carries out a search of the pixels whose RGB color satisfies Eqs (1)-(3). The procedure is called bounded RGB method because it has to fulfill different constraints, as illustrated in the Figure 4b. The output of the processed image shows an important improved compared to that

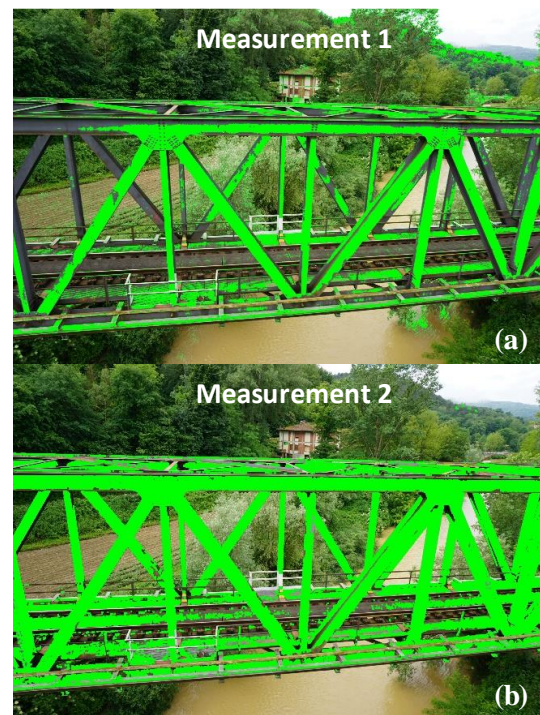

**Fig 4** Result coming from measurement 1 (a) and 2 (b) respectively with simple and bounded RGB method obtained through the previous analysis (Measurement 1). Indeed, almost all structural

elements have been entirely selected especially regarding the external and vertical ones. Consequently, the information taken by the use of this command is more refined affecting the defect extension evaluation through the following parameters: the number of pixels of the structure without defect, number of pixels of the defected area, ratio between these two values and defected area evaluation. Finally, it is worth noting that the

recognition of the elements/defects on a single image takes less than a minute.

solutions of Aibotix and Hexagon orthophotos, 3D models and high-density point clouds with great accuracy can be generated. The flight planning software Aibotix AiProFlight allows obtaining all

### 3. Procedure validation

In this section the results obtained processing images are illustrated and analyzed as taken in several railway bridges belonging to the Italian National Network. In particular, five samples have been considered: one steel (A) and four masonry bridges (B, C, D, E). For each bridge, we collected about two hundred of pictures; therefore, the method was massively applied to a large number of images. A parameter sensitivity analysis is also reported in the last part of the paper to discuss the effects in the selection for the ranges in Eqs. (2) and (3).

The first one is a railway steel bridge, while the masonry ones are arch bridges. In all cases, according to the proposed procedure, the data acquisition is performed by using Aibot X6, which is a flying hexacopter, specifically designed for demanding tasks in surveying, industrial inspection, agriculture and forestry. Equipped with a high level of artificial intelligence, this UAV reaches any target and can independently create high-resolution images and videos. It is also suited for autonomous flight mode. An unmatched feature of the Aibot X6 offers the possibility to adapt various kinds of sensors such as hyper- and multi-spectral sensors, infrared and thermal sensors, and sensors for other industry-specific missions. A new spin on photogrammetry surveying of the future is not fixed and static, but dynamic and flexible. With the data captured by the Aibot X6 commercial UAV and the software

the parameters essential for proficient photogrammetry.

Data analysis was carried out by using the developed procedure described in Section 2, following a predetermined sequence for each bridge to tether a preordered sequence of structural elements, as it is acquired in DOMUS. Although possible, at this stage the flight was tele operated by an operator through a logical path following the sequence of structural elements that facilitated to storing of the pictures. The path was following the bridge deck a predefined direction of viability starting from lower distance from Rome. The deck first and piles after.

It has been experimentally verified that following a predetermined sequence for the bridge inspection reduces the time of the survey of at least 15 % and reduces the time of ordering the images for the processing of more than 30%. The data is stored and further processed off-line.

For the cases of study, an UAV was used only.

A ground mobile robot can be also used applying the described procedure. The integration of aerial and ground mobile systems is not addressed in the paper, and it is ongoing work.

In case (A) steel truss-beams have been considered while the bridge abutments and arches are the main elements under observation for cases (B-E). As explained in the previous sections, the image processing of the whole set of photos have been performed using a bounded RGB method (Measurement 2). The 10 parameters needed to define the Eqs (1), (2) and (3), have been set to permit the automation of the recognition of both

structure and defects.

Table 4 contains the values used to identify the structure, the paint absence, efflorescence and vegetation that are usually found in the old masonry abutments. The RGB parameter values applied for the structure recognition are similar for both steel and masonry bridges. This occurrence is due to the close color shades for the two different types of structures.

For opposite reasons, the values for the defect identification are very different in the analyzed cases. Indeed, it is understandable that the paint stripping leaves a surface that has a color tone close to red while the efflorescence and vegetation near to white and green, respectively. Even if there is not a specific role to follow for the choice of RGB values, considerations will be presented in the following sections based on visualization and results obtained for different combinations of the parameters. After this analysis, further steps can be automated.

Figures 6a, 6c and 6e are related to the original images while 6b, 6d and 6f are the processed ones. Three different targets have been pursued in these analyses: in the first case (Figure 6a and 6c) only


**Table 4** Chosen parameters for element and defect recognition

Typology	$R_{min}$	$R_{max}$	$G_{min}$	$G_{max}$	$B_{min}$	$B_{max}$	$RG_{min}$	$RG_{max}$	$GB_{min}$	$GB_{max}$
Steel Bridge	20	190	30	200	20	200	15	15	15	15
Masonry Bridge	20	200	20	200	20	200	20	20	20	20
Paint absence	90	220	50	180	40	170	-5	60	5	40
Efflorescence	140	255	140	255	140	255	20	20	20	20
Vegetation	60	180	60	210	40	150	30	30	-10	60

This is only a choice of the authors to better identify and highlight the corresponding areas and so it has no relation with the RGB method. In particular, in Figure 6d the procedure has been able to capture also paint absence in structural elements not in foreground as the red area found also in the diagonal brace in the background. Instead, the third processing concerns only one structural element, i.e. the longitudinal and horizontal beams picked out by the blue lines in Figure 6e. In this case, the method can be also used to investigate the evolution of a local material degradation.

Figure 7 shows the obtained results in the defects analysis conducted on the masonry retaining wall

the element recognition, in the second both element and defect, while in the third one only defect. It is worth to note that in all processed images, the green color is referred to the element, while the red one to the defect.

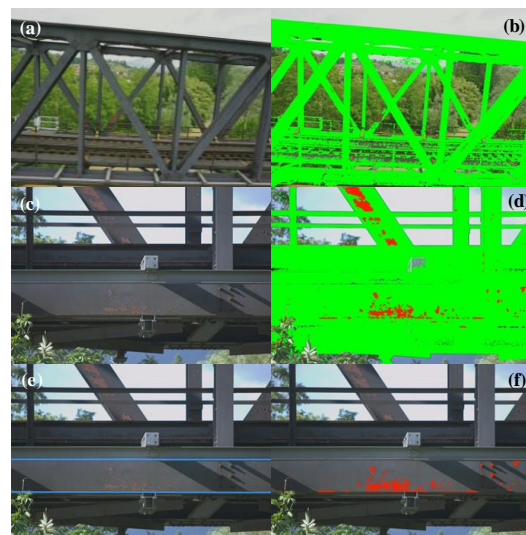


**Fig 3** Steel bridge A: (a), (c) and (e) original and (b), (d), and (f) processed images: Structure and defect recognition

of the shoulder and the pier of the arch for a masonry bridge. Even in this case, in Figure 7a and 7d the original images are given. The aim of the image processing is to show the ability of the procedure to recognize two typical masonry defects: contemporary presence of both efflorescence and vegetation. The exact area to be investigated has been indicated by a contour with blue lines (Figure 7a and 7d). The Figure 7b) and 7e) try to identify the efflorescence. In the literature, this physical effect is related to the migration of a salt on the porous masonry surface phenomenon where it forms a coating. Usually, these occurrences are transient events especially at the end of the construction phase but they can

become chronic due to the presence of the surrounding terrain, behind the porous material or due to polluted rains. In particular, this damage is primarily aesthetic, but it can induce also degradation in the mortar and bricks. For example, in the Figure 7a is well-visible a wide zone affected by efflorescence (lower left) while other smaller parts are spread especially in the top of the masonry. Such areas have been taken looking to the results in the Figure 7b. For the same image, the vegetation is widespread in all surface and even in this case there is a correspondence

between defect and the highlighted pixels (Figure 7c). Interesting it is to note how in the masonry C (Figure 7d) the efflorescence defect is collocated between two areas defected by vegetation.

The results in Figure 7e and 7f show the correct ability of the procedure to recognize rapidly the corresponding extension. Other results on the effectiveness of the proposed procedure are illustrated in Figure 8. In particular, the lateral surfaces of two masonry arch bridges have been analyzed.

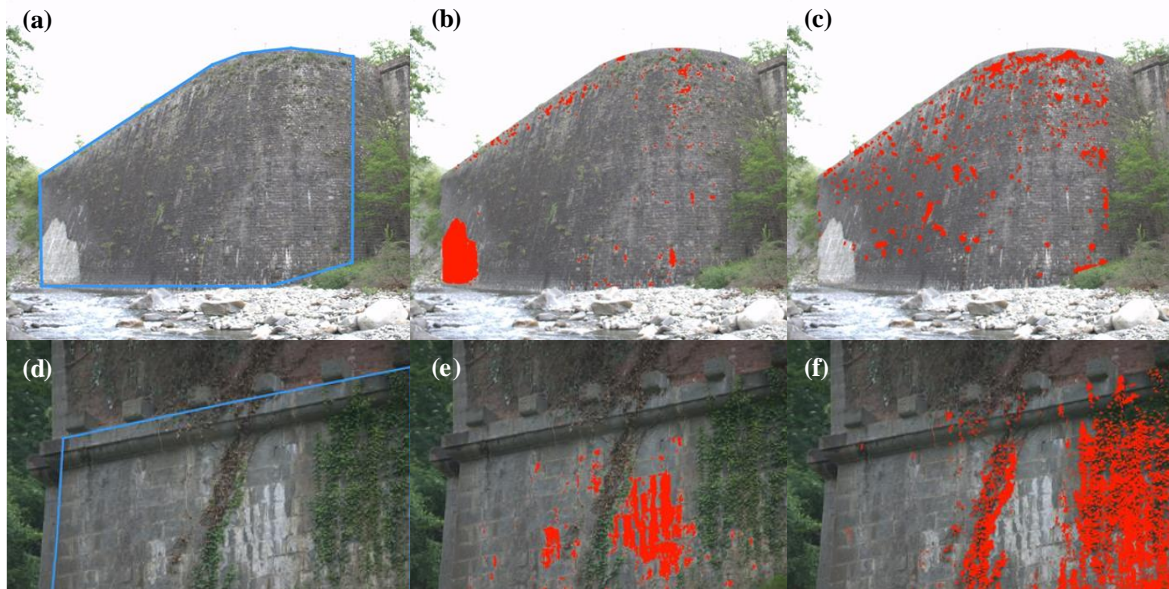

**Fig 4** Elements and defects of masonry bridge B and C: (a), (d) original images, (b), (e), efflorescence, (c), (f) vegetation


In the original images, placed in the left column (Figure 8a, 8c and 8e), efflorescence appears in the mortar between bricks.

The defect highlights the shape of the brick and it is clearly identified in the corresponding processed images (Figures 8b) and 8d). In the left part of Figures 8c and 8d, where is depicted the masonry arch, a portion of the element is hidden by leaves that are in foreground and blurred due to the distance with respect to the observed object. However, the element for which the defect is evaluated is not affected by this disturbance. In Figures 8e and 8f, the vegetation in the brick joints is precisely evaluated.


Figure 9 reports a quantitative evaluation of the defect extension conducted through the proposed

image-processing method. For each analyzed image previously presented, the percentage of surface coverage by the defect respect to the relative structural element has been calculated. Such percentage has been measured through the pixels' ratio between the number of pixels associated to the selected structural element and the ones associated to the defect. For this reason, in each corresponding figure the upper part of the Table presents the number of pixels for the structure (S) and for the defect (D). Moreover, Figure 9a summarizes the results obtained in the evaluation of the number of pixels related to a defect with respect the number of pixels related to an element of the steel bridge, while Figures 9b and 9c for the masonry ones. In the first case, the

evaluation conduces to low portion of the area affected by the painting absence determining the percentage of defective area. Differently, in Figure 9b a relatively large portion of the considered element has been found affected by a defect of vegetation. The result agrees with a rough visual estimation of the inspector, which can look directly at the original image (Figure 7d). Instead, in Figure 9c the displayed results show that looking at two different portion of the same bridge an exact comparison of defect extension can be done only through the proposed procedure, which permits to determine, in a situation difficult to analyze by the inspector, which is the portion of the bridge more affected by the efflorescence defect. Even if the developed tool permits only a fast evaluation of the defect extension based on the RGB method, which is a possible choice for the color space, the procedure appears reasonable for the aim of the entire process and for its capacity to be automated in the processing of a large number of images.

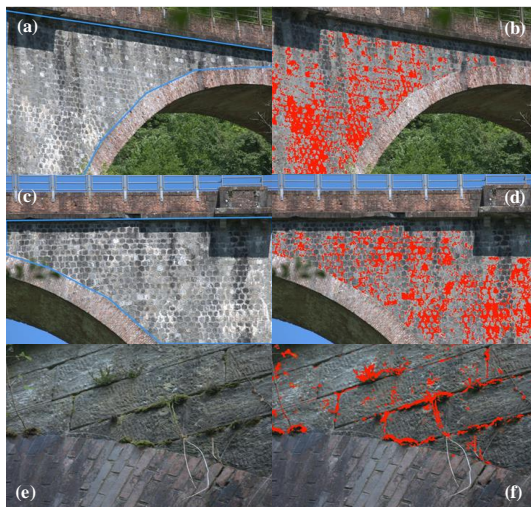

**Fig 5** Masonry bridge D: (a)-(d) original images and efflorescence defect. Masonry bridge E: (e), (f) original image and vegetation defect

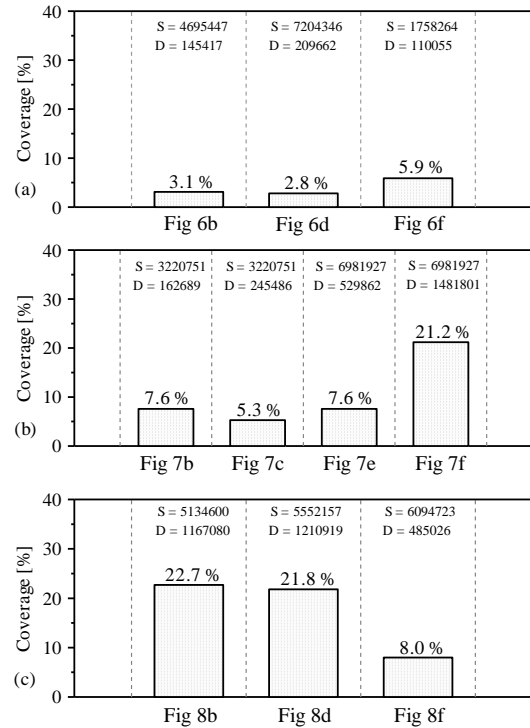

**Fig 9** Presence of the defect in percentage for the processed images. S and D indicate the number of pixels for structure and defect respectively

The proposed procedure can be used for other types of defects, which are characterized by evident superficial color change by properly setting the ranges of the parameters.

Other specific techniques should be used for cracks and spalling as it has recently presented in [48]. Notwithstanding the possibility to enhance the process, the presented results allow to obtain reasonable information reducing time and cost, increasing the observation and consequently the safety related to unknown and unobserved defects.

### 3.1 Robustness evaluation

In this paragraph, the image-processing procedure robustness is determined by a series of analyses conducted on the evaluation data.

Figure 10 illustrates a comparison between the results obtained in the defect extension evaluation using the RGB bounded method (Figures 10b) and 10c) and a CAD-aided procedure (i.e. by tracing the edges of the structure and defect in Computer-Aided Design, CAD, environment from the

original image, as provided in Figures 10d and 10e).

In Figure 10a the original image, processed by the two methods, is reported. It is worth to observe that this image represents the lateral view of a steel railway bridge and it can only be acquired using the aforementioned agents (robots or drones) because it cannot be accessed directly.


The following observations can be drawn:

1. both methods depend on the image resolution;
2. regarding to the area related to the elements, the manual method provides more accurate results, while the RGB bounded one is faster;
3. differences between the two procedures can

be assumed as minimal (indeed, the ratio between the defected area over the structure is 5.66 % and 4.42 % for the RGB bounded method and the manual one, respectively);

4. RGB bounded method provides a greater percentage value because a few number of pixels have been associated to other objects, highlighted in the background.

In Figure 11, a sensitivity analysis is illustrated varying the admissibility range for Eqs. (1)-(3). In particular, the following variables have been defined

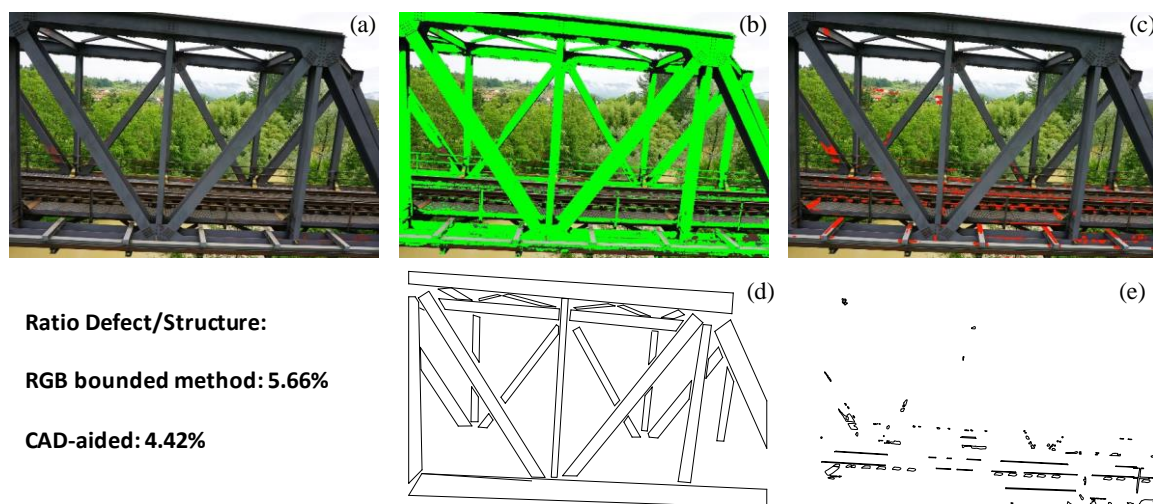

**Fig 10** Comparison between the results obtained through the RGB bounded method and a CAD-aided one: (a) original image, (b) structure and (c) defect detection in RGB bounded method; CAD-aided procedure: (d) structure and (e) defect.

$$\Delta_1 = R_{max} - R_{min} \quad (4)$$

$$\Delta_2 = G_{max} - G_{min} \quad (5)$$

$$\Delta_3 = B_{max} - B_{min} \quad (6)$$

$$\Delta_4 = RG_{max} - RG_{min} \quad (7)$$

$$\Delta_5 = GB_{max} - GB_{min} \quad (8)$$

In the analysis, the defect damage percentage (paint absence) has been evaluated by varying one


of the range variable defined by Eqs. (4)-(8) and keeping the other ones fixed to the values used in Table 2 in the row called “paint absence”.

Figure 11a is related to the variation of the first variable  $\Delta_1$  corresponding to the interval of the red color of the Eq. 1. The other figures start from three different values of the range  $\Delta_1$  giving rise three different paths (solid, dot and dash-dot line). In particular, these values are the following, a named optimal value (opt)  $\Delta_1 = 130$ , the value (A-point)  $\Delta_1 = 120$ , the value (B-point)  $\Delta_1 = 140$ . The results of the analysis permit to highlight the following observations:

1. from the first three figures, it can be observed that among the RGB-parameter, the one more sensitive to the analyzed defect extraction is the Red color.
2. even when there are differences in the choice of the range  $\Delta_1$  (from 120, A-point, to 140 B-point) large changes of the evaluated damage percentage are not observed. Indeed, looking at the reasonable minimum and maximum values that should be considered, which are in correspondence of the triangle and square symbols respectively, the difference in the obtained results in terms of defect extension is about 1%. This observation can be supported looking to the processed images reported in the lower row of Figure 11. The paths corresponding to the ranges of the A-

point, opt-point and B-point are very similar each other in Figures 11b, 11c, 11d and 11e.

3. when the range for the choice of the R-parameter is very large (B-point) the damage percentages assume the highest values vice versa in the A-point (narrow range).
4. finally, in the Figure 11e three maximum points can be observed, one for each path. The optimum in the  $\Delta_5$  parameter is independent with respect to the other parameters, which is a feature that permits to highlight the importance of the introduction of the inequality expressed by Eqs. (2)-(3). The results indicate that the color pattern associated to the defect has its own structure.

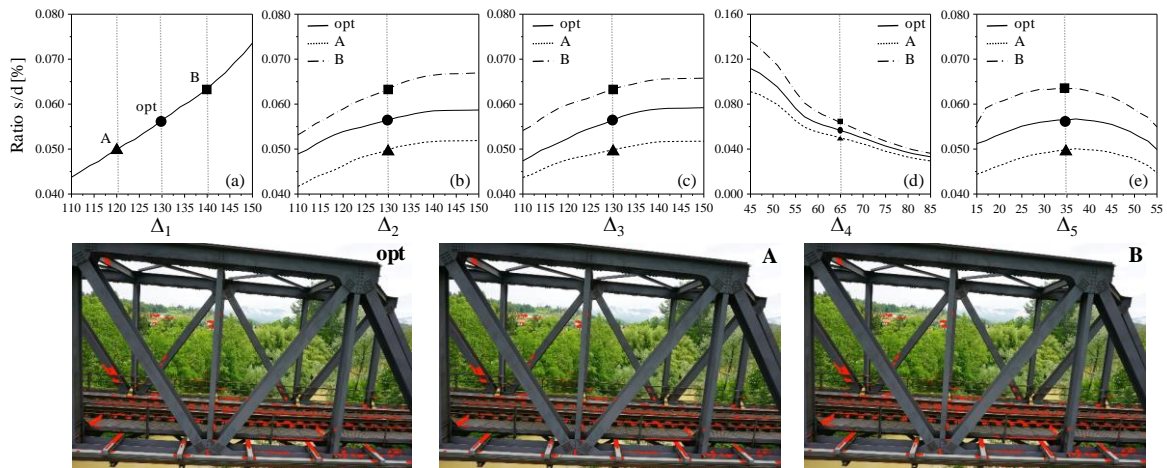

**Fig 11** Sensibility analysis varying the limits of the intervals in the Eqs (1)-(3). The images below are related to the ranges defined in corresponding of points opt, A and B

#### 4. Conclusions

This research has been focused on the definition of a suitable procedure for bridge inspection, which it is assisted by color-based image processing on data acquired through Unmanned Aerial Vehicle (UAV). In particular, the procedures and the proposed algorithm have been developed according to the bridge management system currently used for the Italian National Railway Network. Steel and masonry bridges have been

used as illustrative real cases of study. The robotics and computer-aided procedure enables quantitative evaluation of defect extension by analyzing data contained in digital images taken on pre-classified structural elements. A color-based algorithm has been used for the damage detection and quantification. A software named DEEP has been proposed in order to identify and quantify superficial defects such as paint absence, efflorescence, and vegetation on structural elements. For this kind of defects, that are wide, extensive and not characterized by a shape, the Color Detection Technique is effective. The proposed procedure has been validated through



comparison with a CAD-aided evaluation of the extension of specific superficial defects, evidencing the significant reduction of the human time realized by the proposed procedure to analyze images. Furthermore, the computer-assisted treatment of images taken by robots allows to evaluate defect extension that human eye cannot even access and precisely quantify.

### Acknowledgments

The research leading to these results has received funding from the Italian Government under Cipe resolution n.135 (Dec. 21, 2012), project *INnovating City Planning through Information and Communication Technologies*.

The results of the steel bridge is part of a project that has received funding from the *Research Fund for Coal and Steel* under grant agreement No 800687.

### References

- Phares BM, Rolander DD, Graybeal BA, Washer GA (2001). Reliability of visual bridge inspection. *Public Roads* 64(5).
- Kim H, Sim SH, Cho S (2015) Unmanned Aerial Vehicle (UAV)-powered Concrete Crack Detection based on Digital Image processing. In: Proceedings of the 6th International Conference on Advances in Experimental Structural Engineering, 1-2 August, Urbana-Champaign, Illinois.
- Gattulli V, Chiaramonte L (2005) Condition Assessment by Visual Inspection for a Bridge Management System. *Computer-Aided Civil and Infrastructure Engineering* 20:95-107.
- Yeum CM, Dyke SJ (2015) Vision-Based Automated Crack Detection for Bridge Inspection. *Computer-Aided Civil and Infrastructure Engineering* 30: 759-770.
- Lee S, Kalos N (2015) Bridge inspection practices using non-destructive testing methods. *Journal of Civil Engineering and Management* 21(5):54-665.
- Izumi Y, Sakagami T, Kubo S, Tamakoshi T (2008) Nondestructive Evaluation of Fatigue Cracks in Steel Bridges by Infrared Thermography. In: Proceedings of ASCE 2008 International Orthotropic Bridge Conference, 25-29 August, Sacramento, California.
- Sakagami T, Izumi Y, Kubo S (2010) Application of infrared thermography to structural integrity evaluation of steel bridges. *Journal of Modern Optics* 57(18):1738-1746.
- Kim H, Lee J, Ahn E, Cho S, Shin M, Sim S (2017) Concrete Crack Identification Using a UAV Incorporating Hybrid Image Processing. *Sensors* 17(9):1-14.
- Lim RS, La HM (2014) A Robotic Crack Inspection and Mapping System for Bridge Deck Maintenance. *IEEE Trans on Automation Science and Engineering* 11(2):367-378.
- Salman M, Baporikar V (2015) Image Based Detection and Inspection of Cracks on Bridge Surface Using an Autonomous Robot. *International Journal on Recent and Innovation Trends in Computing and Communication* 3(2):23-27.
- Hirose S, Tsutsumitake H (1992) Disk Rover: A Wall-Climbing Robot Using Permanent Magnet Disks. In: Proceedings of IEEE/RSJ International Conference on Intelligent Robots and Systems, Raleigh, North Carolina.
- Figliolini G, Rea P, Conte M (2010) Mechanical Design of a Novel Biped Climbing and Walking Robot. In ROMANSY 2010, 18th CISM-IFTOMM Symposium on Robot Design, Dynamics, and Control. 199-206.
- Ottaviano E, Rea P, Castelli G (2014) THROO: a Tracked Hybrid Rover to Overpass Obstacles. *Advanced Robotics* 28(10): 683-694.
- Ottaviano E, Rea P (2013) Design and operation of a 2-DOF leg-wheel hybrid robot. *Robotica* 31(8):1319-1325.
- Guo L, Rogers K, Kirkham R (1997) A Climbing Robot with Continuous Motion. In: Proceedings of IEEE International Conference on Robotics and Automation, 21-27 April, Albuquerque, New Mexico.
- Savall J, Avello A, Briones L (1999) Two Compact Robots for Remote Inspection of Hazardous Areas in Nuclear Power Plants. In: Proceedings of IEEE International Conference on Robotics and Automation, Detroit, Michigan.
- Hallerman N, Morgenthaler G (2014) Visual inspection strategies for large bridges using Unmanned Aerial Vehicles. In: Proceedings of 7th International Conference on Bridge Maintenance, Safety, Management and Life Extension, CRC Press, 7-11 July, Shanghai, China.
- Gattulli V, Ottaviano E, Pelliccio A (2018) Mechatronics in the Process of Cultural Heritage and Civil Infrastructure Management, Chapter in Ottaviano, Pelliccio and Gattulli Eds, Springer.

19. Liu YF, Cho S, Spencer BF, Fan J (2014) Automated assessment of cracks on concrete surfaces using adaptive digital image processing. *Smart Structures and Systems* 14:719-741.
20. Chen FC, Jahamshahi MR, Wu RT, Joffe C (2017) A texture- Based Video Processing Methodology Using Bayesian Data Fusion for Autonomous Crack Detection on Metallic Surfaces. *Computer-Aided Civil and Infrastructure Engineering* 32:271-287.
21. Valvona F, Toti J, Gattulli V, Potenza F (2017), Effective seismic strengthening and monitoring of a masonry vault by using Glass Fiber Reinforced Cementitious Matrix with embedded Fiber Bragg Grating sensors. *Composites Part B: Engineering* 113:355-370.
22. Potenza F, Federici F, Lepidi M, Gattulli V, Graziosi F, Colarieti A (2015) Long term structural monitoring of the damaged Basilica S. Maria di Collemaggio through a low-cost wireless sensor network. *Journal of Civil Structural Health Monitoring* 5(5): 655-676.
23. Viola P, Jones M (2001) Rapid object detection using a boosted cascade of simple features. In: *Proceedings of the 2001 IEEE Computer Society Conference on Computer Vision and Pattern Recognition, CVPR 2001*, 8-14 December, Kauai, Hawaii.
24. Bay H, Ess A, Tuytelaars T, Van Gool L (2008) Speeded-Up Robust Features (SURF). *Computer Vision and Image Understanding* 110(3):346-359.
25. Theo Gevers, Joost van de Weijer, Harro Stokman (2006) Color feature detection. Rastislav Lukac and Konstantinos N. Plataniotis. *Color image processing: methods and applications*, 9, CRC press, pp.203-226, 978-0-8493-9774-5.
26. Khan FS, Anwer RM, Van De Weijer J, Bagdanov AD, Vanrell M, Lopez AM (2012) Color attributes for object detection. In: *Proceedings of Computer Vision and Pattern Recognition (CVPR)*, 2012 IEEE, 16-21 June, Providence, Rhode Island.
27. Potenza F, Castelli G, Gattulli V, Ottaviano E (2017) Integrated Process of Images and Acceleration Measurements for Damage Detection. In: *Proceedings of 10th International Conference on Structural Dynamics, EURO-DYN 2017*, 10-13 September, Rome, Italy.
28. Khattab D, Ebied HM, Hussien AS, Tolba MF (2014) Color Image Segmentation Based on Different Color Space Models Using Automatic GrabCut. Hindawi Publishing Corporation, *The Scientific World Journal*, Article ID 126025.
29. Jung H, Lee C, Park G (2017) Fast and non-invasive surface crack detection of press panels using image processing. In: *Proceedings of 6th Asia Pacific Workshop on Structural Health Monitoring, 6th APWSHM*, 7-9 December, Hobart, Australia, *Procedia Engineering*, 188, 72-79.
30. Wang X, Hänsch R, Ma L, Hellwich O (2014) Comparison of different color spaces for image segmentation using graph-cut. In: *Proceedings of the International Conference on Computer Vision Theory and Applications (VISAPP)*, 5-8 January, Lisbon, Portugal.
31. Abdel-Qader I, Pashaie-Rad S, Abudayyeh O, Yehia S (2006) PCA-based Algorithm for Unsupervised Bridge Crack Detection. *Advances in Engineering Software* 37(12): 771-778.
32. Fujita Y, Hamamoto Y (2005) A Robust Automatic Crack Detection Method from Noisy Concrete Surfaces. *Machine Vision and Applications* 22(2): 245-254.
33. Saar T, Talvik O (2010) Automatic Asphalt Pavement Crack Detection and Classification using Neural Networks. In: *Proceedings of the 12th Biennial Baltic Electronics Conference*, 4-6 October, Tallin, Estonia.
34. Chen Z, Hutchinson TC (2010) Image-based framework for concrete surface crack monitoring and quantification. *Advances in Civil Engineering* Article ID 215295.
35. Nishikawa T, Yoshida J, Sugiyama T, Fujino Y (2012) Concrete crack detection by multiple sequential image filtering. *Computer-Aided Civil and Infrastructure Engineering* 27(1): 29-47.
36. Jahanshahi MR, Masri SF (2012) Adaptive vision-based crack detection using 3D scene reconstruction for condition assessment of structures. *Automation in Construction* 22:567-576.
37. Cha YJ, Choi W, Büyüköztürk O (2017). Deep Learning-Based Crack Damage Detection Using Convolutional Neural Networks. *Computer-Aided Civil and Infrastructure Engineering* 32(5): 361-378.
38. Cha YJ, Choi W, Suh G, Mahmoudkhani S, Büyüköztürk O (2017) Autonomous Structural Visual Inspection Using Region-Based Deep Learning for Detecting Multiple Damage Types. *Computer-Aided Civil and Infrastructure Engineering* 33:731-747.
39. Lin YZ, Nie ZH, Ma HW (2017) Structural Damage Detection with Automatic Feature-extraction through Deep Learning. *Computer-Aided Civil and*

- Infrastructure Engineering 32(12): 1025-1046.
40. Xu Y, Bao Y, Chen J, Zuo W, Li H (2019). Surface fatigue crack identification in steel box girder of bridges by a deep fusion convolutional neural network based on consumer-grade camera images. *Structural Health Monitoring* 18(3): 653-674.
  41. Cruz-Ramirez SR, Mae Y, Arai T, Takubo T, Ohara K (2011) Vision-based hierarchical recognition for dismantling robot applied to interior renewal of buildings. *Computer-Aided Civil and Infrastructure Engineering* 26(5): 336-355.
  42. Liu YF, Cho S, Spencer BF, Fan J (2016) Concrete crack assessment using digital image processing and 3D scene reconstruction. *Journal of Computing in Civil Engineering* 30:1-19.
  43. Chen ZQ, Chen J (2014) *Mobile Imaging and Computing for Intelligent Structural Damage Inspection*. Hindawi Publishing Corporation, *Advances in Civil Engineering*, Article ID 483729.
  44. Ottaviano E, Vorotnikov S, Ceccarelli M, Kurenev P (2011) Design improvements and control of a hybrid walking robot. *Robotics and Autonomous Systems* 59:128-141.
  45. Rea P, Ottaviano E (2018) Design and Development of an Inspection Robotic System for Indoor Applications. *Robotics and Computer Integrated Manufacturing* 49:143-151.
  46. Kang D, Cha YJ (2018) Autonomous UAVs for Structural Health Monitoring Using Deep Learning and an Ultrasonic Beacon System with Geo-Tagging. *Computer-Aided Civil and Infrastructure Engineering* 33(10), 885-902.
  47. Wang C-C, Thorpe C, Thrun S; Hebert M, Durrant-Whyte H (2007) Simultaneous Localization, Mapping and Moving Object Tracking. *Int. J. Robot. Res.* 26(9): 889-916.
  48. Ni F, Zhang J, Chen ZQ (2018) Zernike-moment measurement of thin-crack width in images enables by dual-scale deep learning. *Computer-Aided Civil and Infrastructure Engineering* 34(5):367-384.